



Advisory Notice for Titan Tornado Aircraft

January 21, 2003

Inspection required before any further flights

Aircraft affected:

- All Tornado II S model aircraft

Aircraft not affected:

- Aircraft other than the Tornado II S model

Circumstances:

It has come to our attention that there may be some S model Tornados that have been assembled without any means of preventing the fuel tank from sliding forward. The aileron controls could jam if the fuel tank slides forward.

Type of inspection required:

Check to see if a Fuel Tank Stop Bracket (TP02-244) is installed where the forward end of the tail boom attaches to the fuselage as per drawing number B 03-INS-1391.

Corrective action:

If there is no Fuel Tank Stop Bracket (TP02-244), it needs to be installed as per drawing number B 03-INS-1391.

Contact Titan Aircraft: 440-275-3205 or email support@titanaircraft.com with any questions or concerns or to order a bracket.

Best regards,

A handwritten signature in blue ink that reads "John Williams".

John Williams
President
Titan Aircraft